LINCOLN-LANCASTER COUNTY HEALTH DEPARTMENT

2200 ST. MARYS
LINCOLN, NEBRASKA 68502

FILE NO. 1837-C

INDIVIDUAL SEWAGE SYSTEM CONSTRUCTION
TYPE OF PERMIT

April 12, 1982
THIS PERMIT EXPIRES

ALBYCE A. PENTICO 4820 RENTWORTH DRIVE LINCOLN, NE 68516
ISSUED TO ADDRESS

T11N, R5E, SECTION SE¼ of 5
LEGAL DESCRIPTION

REMARKS: NONTRANSFERABLE

PERMIT	INSPECTION FEE	OCCUPATION TAX	TOTAL
$ 60.00	$	$	$ 60.00
ACCOUNTING NO.	ACCOUNTING NO.	ACCOUNTING NO.	CODE
	110.16	148.14	6-2

RECEIPTED BY DATE AMOUNT

VALID RECEIPT ONLY IF RECEIPTED IN THIS SPACE

HEALTH
ISSUING OFFICER

2832

THIS PERMIT IS ISSUED AS PROVIDED BY COUNTY RESOLUTION NO. _____

20109-0977

FORM 20103-0477
REQUEST FOR SITE CLEARANCE AND PERMIT
FOR INDIVIDUAL SEWAGE DISPOSAL SYSTEM
City Ordinance No. 9150 ☐
County Resolution No. 2832 ☒

LINCOLN-LANCASTER COUNTY HEALTH DEPARTMENT
Division of Environmental Health
2200 St. Marys Avenue
Lincoln, Nebraska 68502
Phone: 474-1541

A

FILING FEE: $60.00

FILE NO. 1837-C

DATE: Oct 12 1981

The undersigned hereby requests SITE CLEARANCE and PERMIT to construct an Individual Sewage Disposal System in conformance with appropriate resolution or ordinance, as described herein:

1. Legal description of property: Twp. 11N ; Range 5E ; Section SE 1/4 SW corner 5;
   Block _____: Lot 101 I.T. : Addition _____
   Street Address _____

2. Property Use: Residential ☒ ; Commercial ☐ Other Use ☐
   No. of Bedrooms 3 . Describe _____

3. Type of Individual Sewage Disposal System: Septic Tank ☒ ; Other ☐

4. Distance to public sewer: _____ ft.

Lollipop Pet Co. Co
by Reid Poulos
Signature of Applicant (Owner or Lessee)

4820 RENTWORTH DRIVE
Address
68516

(Do not write below this double line)

1. Health Department: Date Rec'd. 10/12/81. Date Frwd. 10/12/81. ACTION: Approved ☒ Disapproved ☐ Signature: Jerrold C. Hood

2. Supt. Bldg. Insp.: or Village Clerk Date Rec'd. 10/12/81. Date Frwd. _____. ACTION: Approved ☒ Disapproved ☐ Signature: Walt Fulton

3. City or County Engineer: Date Rec'd. 10/12/81. Date Frwd. 10/12/81. ACTION: Approved ☒ Disapproved ☒ Signature: Larry Dubnell Dep.

REMARKS OR REASONS FOR DISAPPROVAL _____

Site Visits:
Date: 10/29/81 by: J.C.H.
Date: _____ by: _____
Date: _____ by: _____

INSTALLATION FINAL WRITTEN APPROVAL
Date: 11/6/81 By: Jerrold C. Hood

White: Health Dept. Copy
Yellow: Engineers Copy
Pink: Bldg. Inspector's Copy

*SECOND MANHOLE NEEDED IN SEPTIC TANK 11/6/81 REPORTS INSTALLED

FORM 20105-0477
SOIL ABSORPTION TEST DATA REPORT
(Annex to Application)
(Reference: City Ordinance No. 9150 and County Resolution No. 2832)

LINCOLN-LANCASTER COUNTY HEALTH DEPARTMENT
Division of Environmental Health
2200 St. Marys Avenue
Lincoln, Nebraska 68502
Phone: 474-1541

B

FILE NO. _____

PROPERTY WHERE SOIL TESTED:

Location: Township 11N ; Range 5E ; Section & ¼ Section S.E¼ 5. - SW corner
Property Dimensions: _____ ft. x _____ ft. Area: 10.8 acres. (Attach Sheet C with sketch of property).
Soil Type: Silty Clay ☐ ; Silty Clay Loam ☑ ; Sandy Loam ☐ ; Silt Loam ☐ ; Clay Loam ☐ .
Dates of Tests: 10/7/81 to 10/8/81 . Weather: Precip. dry Temp. 70° .

OWNER: Glenn Baumberger
Address: % Pottyco Inc @ 4820 Rent Worth Dr. Lincoln, Nebr.

PERCOLATION TEST DATA TABLE

a.	b.	c.	d.	e.	f.	g.	h.	i.	j.	k.	l.	m.	n.
		Pre-Saturation Period				Percolation Readings						Results	
		Start		End		Start			End				
Hold No.	Hole Depth (in.)	Date (Mo./ Day)	Time (Hr./ Min.)	Date (Mo./ Day)	Time (Hr./ Min.)	Date (Mo./ Day)	Time (Hr./ Min.)	Water Level (in.)	Time (Hr./ Day)	Water Level (in.)	Elapsed Time (Min.)	Water Level Drop (in.)	Percolation Rates (Min./in.)
1	32"	10/7	9:00	10/8	8:00	10/8	11:30	3¼"	12:00	2½"	30	¾"	
2	33"						11:33	3"	12:03	2⅛"	30	⅞"	
3	34"						11:35	4¼"	12:05	3½"	30	¾"	
4	34"						11:39	3⅜"	12:09	3⅛"	30	⅝"	
5	34"						11:40	4"	12:10	3⅜"	30	⅞"	
6	34"						11 42	3½"	12:12	2¾	30	¾"	

Sum of Percolation Rates: _____
Average of Rates: _____
Mean of Rates: _____

Contractor for Pottyco Inc.
Signature of Person Conducting Test

Address 4820 Rentworth Dr. Phone 423-0121

(Do not write below this line)

REVIEWING ACTION

Remarks: 10/29/81 Lot of Iron Oxide present
Soil Type (SCS): Sharpsburg Silty Clay Loam
Date: October 12, 1981

Approved Percolation Rate (a)
A. 40 min./inch
B. _____ min./inch
C. _____ min./inch

Jerrold C. Hood
Signature of Reviewing Official

FORM 20102-0477
PRELIMINARY PLANS & SPECIFICATIONS FOR SEWAGE DISPOSAL SYSTEM (Annex to Application)
City Ordinance No. 9150 ☐
County Resolution No. 2832 ☒


LINCOLN-LANCASTER COUNTY HEALTH DEPARTMENT
Division of Environmental Health
2200 St. Marys Avenue
Lincoln, Nebraska 68502
Phone: 474-1541

C

Sketch of property showing Percolation Test hole locations, well, residence, direction and property line.

FILE NO. _____

Indicate on sketch if residence and well are exisiting or proposed.

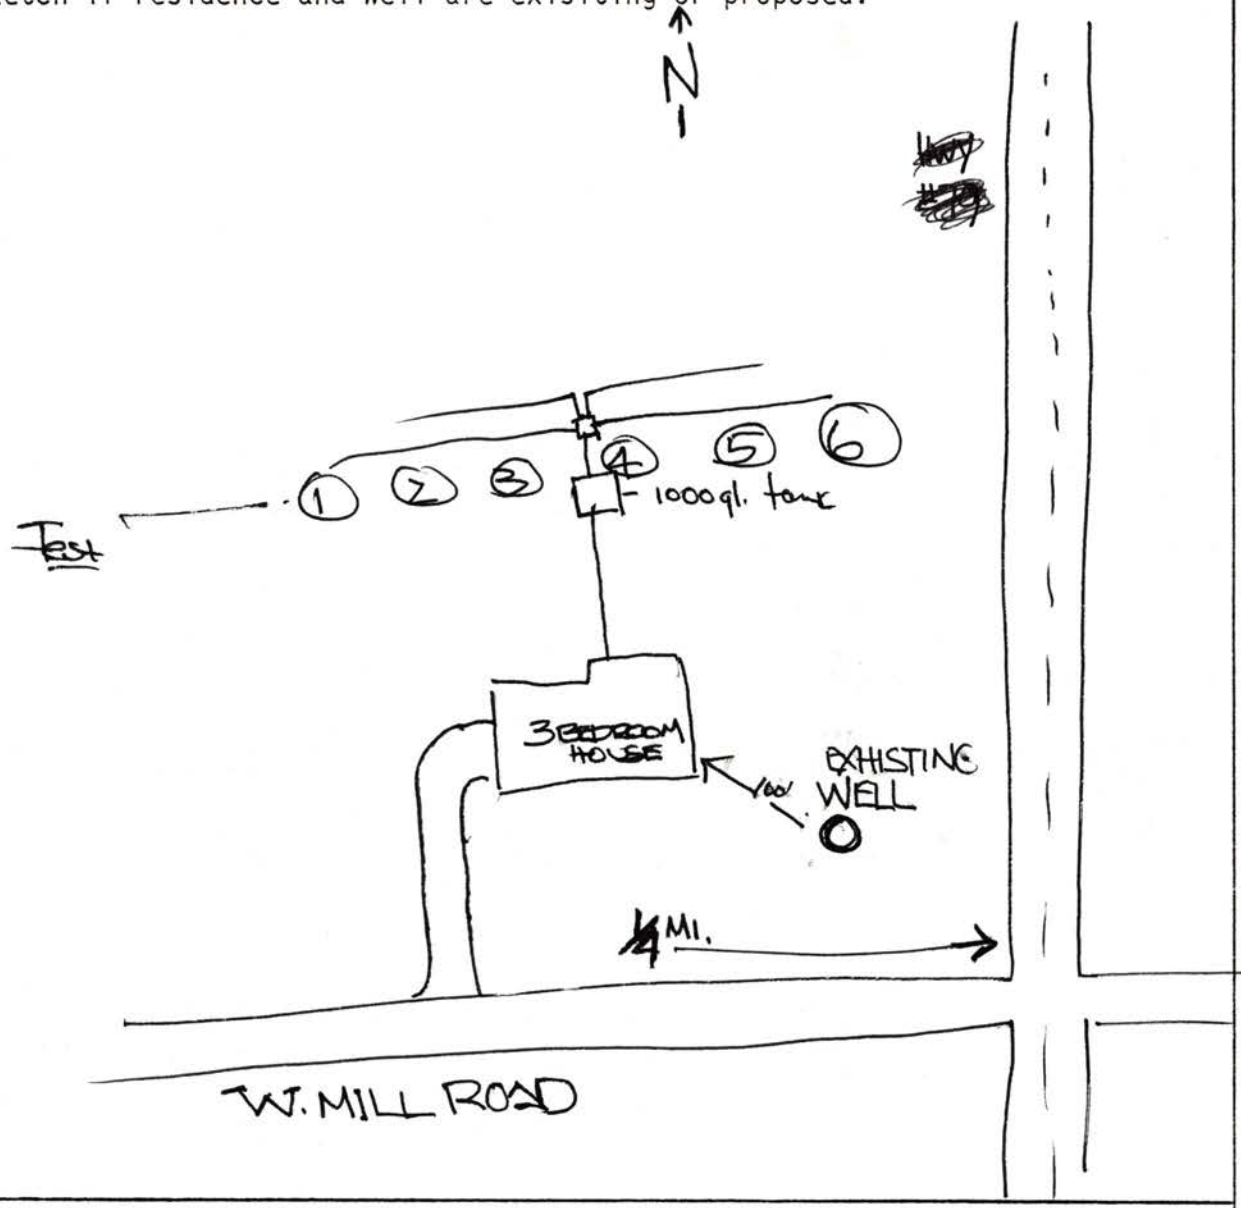

REVIEWING ACTION

Remarks: _____

Date: October 12, 1981

Minimum Design Requirement
1. Capacity of Septic Tank 1000 gals.
2. Total Length of Laterals 287 ft.
3. With a Trench Width of 36 in.
4. Total Area of Lateral needed 862 sq.ft.

Jerrold C. Hood
Signature of Reviewing Official

REC'D NOV 9 1981

FORM 20104-0477
PLANS & SPECIFICATIONS FOR SEWAGE DISPOSAL SYSTEM (Annex to Application)
City Ordinance No. 9150 ☐
County Resolution No. 2832 ☐

LINCOLN-LANCASTER COUNTY HEALTH DEPARTMENT
Division of Environmental Health
2200 St. Marys Avenue
Lincoln, Nebraska 68502
Phone: 474-1541

D

DATE: 10-29-81

FILE NO. _____

SPECIFICATIONS AS BUILT


11800 W. Mill Rd.
Glen Baumberger

A. BUILDING SEWER:
1. Material PVC; Diameter 4 in.
2. Distance above basement floor _____ in., or below basement floor 36 in.
3. Distance between dwelling and septic tank 55 ft.
4. Number of clean-outs 1.
5. Distances to: Well or Suction Line 100 ft.; Stream — ft.; Pressure Line _____ ft.; Property Line _____ ft.

B. SEPTIC TANK:
1. Material Fiberglass; No. of compartments 1.
2. Capacity 1000 gals.;
3. Factory Built: Yes ☒ No ☐ (Company Correglass)
4. Manholes: Over Inlet; diam. 16 in. Over Outlet; diam. 24 in. Riser Above ☒ Below ☐ Grade 3 in.
5. Inlet: Baffle ☒ ; or Tee ☐
6. Outlet: Baffle ☐ ; or Tee ☒
7. Depth of top of tank below finished grade 24 in.
8. Distances to: Well or Suction Line 115 ft.; Stream — ft.; Pressure Line — ft.; Property Line — ft.

C. DISTRIBUTION BOX:
1. Material Plastic; Number - available outlets 7.
2. Factory Built: Yes ☒ No ☐ (Company Correglass)
3. Distance from Septic Tank 9 ft.

D. ABSORPTION FIELD: (Provide as built drawings on back of this form)
1. Type: Half Rounds ☐ Perforated Pipe ☒ Diameter of Half Round _____ or Perforated Pipe 4" . Material: fiberglass ☐ ; plastic ☒ ; concrete ☐ ; other _____.
2. Lateral Lines: Number 4; Length of each line 100, 100, 30, 60, _____ ft.; Total length of laterals 290 ft.; Distance between lateral lines 10-20 ft.
3. Trench dimensions: Width 3 ft.; Slope 3 in/100 ft.; Average Depth 48-24 in.
4. Filter Material: Road gravel Depth of Material 36-12 in.
5. Distances to: Well or Suction Line 125 ft.; Stream — ft.; Pressure Line _____ ft.; Property Line — ft.

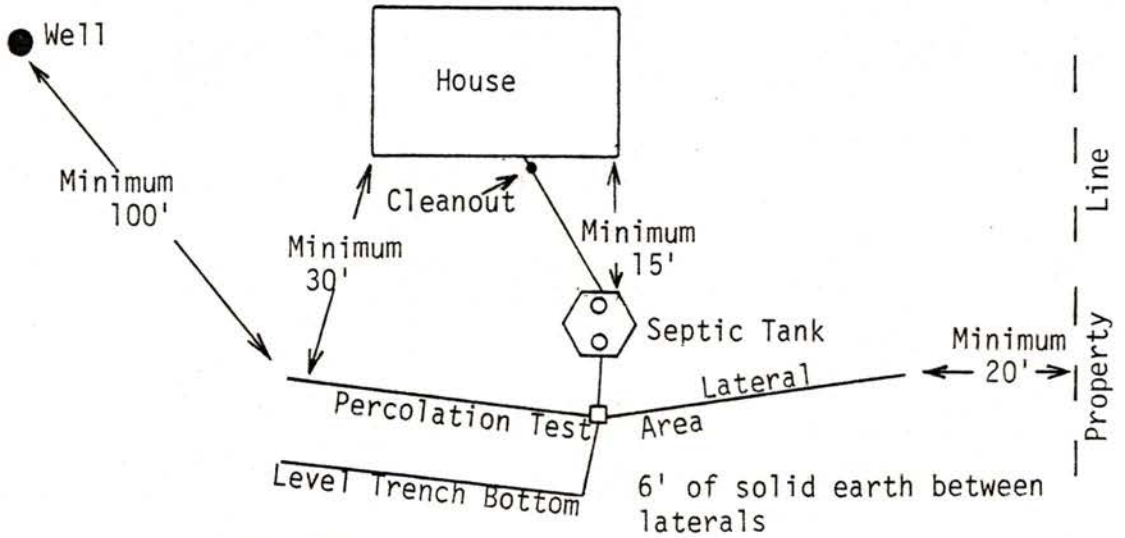


TYPICAL INDIVIDUAL SEWAGE SYSTEM DESIGN

AS BUILT DRAWING OF SYSTEM

DATE 11-29-81 INSTALLER Lo Hy Co Plumbing

P.O. Box 2521
Lincoln, NE. 68502

Well

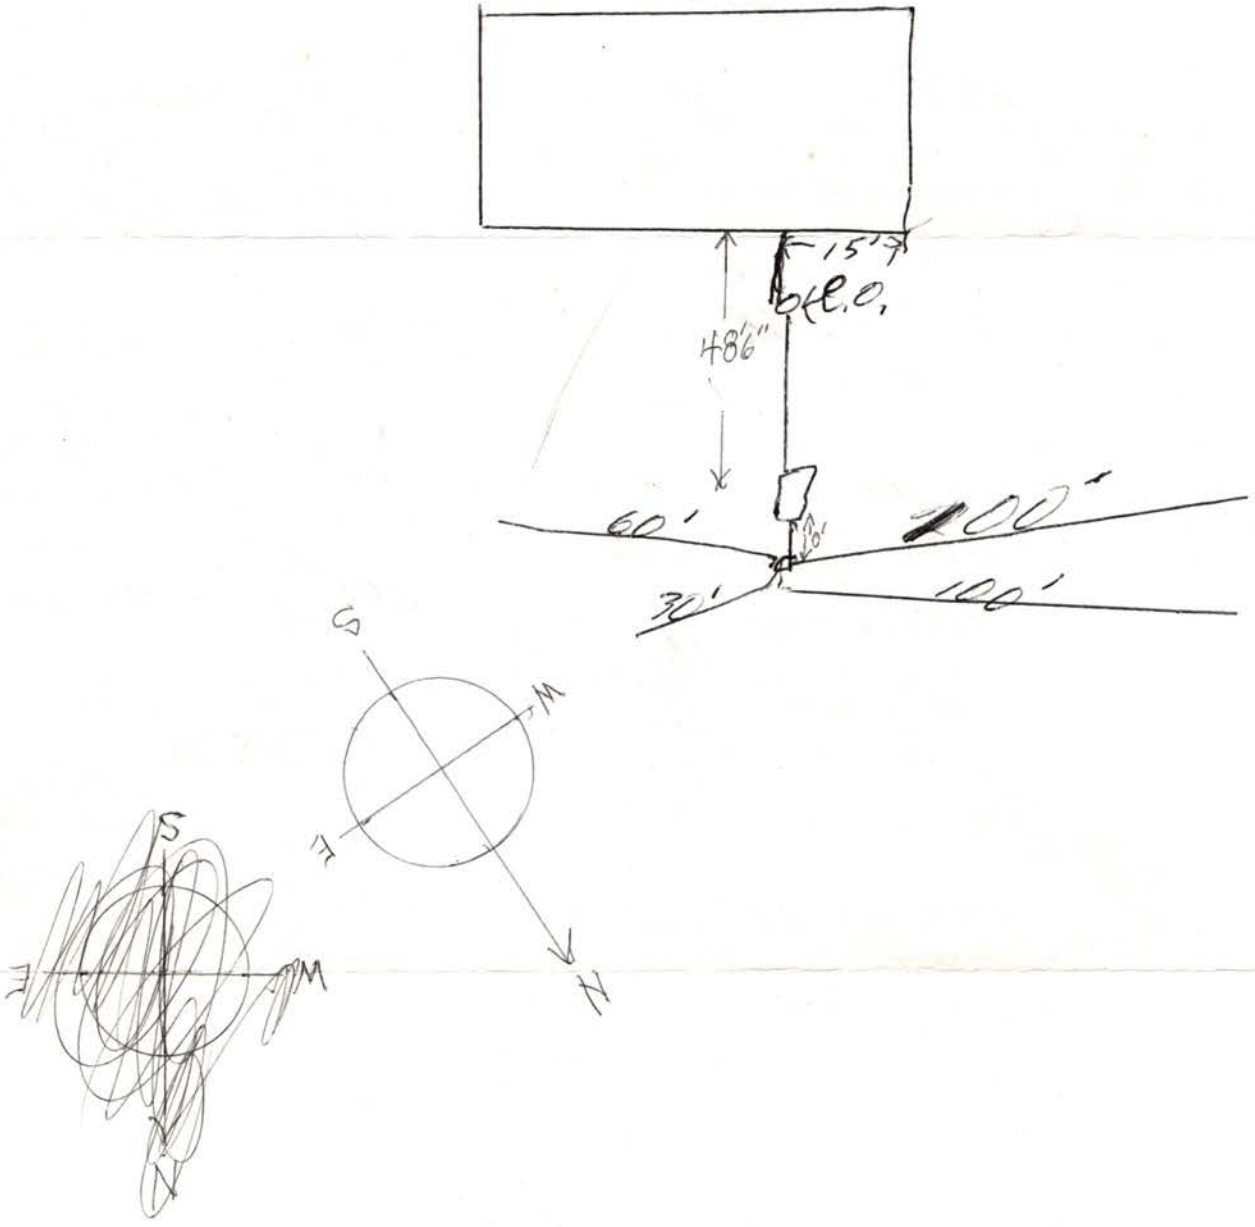

Lincoln-Lancaster County Health Department

3140 "N" Street, Lincoln, Nebraska 68510 Phone: 441-8022

REAL ESTATE TRANSFER/LOAN APPROVAL FORM

This form must be completed and returned to request a real estate transfer inspection.

MAKE CHECK PAYABLE TO: Lincoln-Lancaster County Health Department or LLCHD

☒ Enclosed is $150.00. Allow two weeks for processing. Incomplete information will delay processing.

☐ Evaluation of the Individual Water System ☐ Evaluation of the Sewage Disposal System

Legal Description of Property: Street Address 11800 W MILL RD, MALCOLM, NE

Twp 11 Range 5 Section 5 1/4 SE 1/4 Block ____ Lot 10 Addition ____

Directions to Property ____

Location of Well SOUTH & SE OF HOUSE Tap Location: Inside ☐ Outside ☐

Location of Sewage System EAST AND NE OF HOUSE Year Installed UNKNOWN

	NAME	ADDRESS	PHONE
Present Owner:	GLENDELL J. BOMBERGER IRENE A. BOMBERGER	11800 W MILL RD	402/796-2469
Tenant/Buyer:	CHARLES W. BERRYMAN LAUREL A. BERRYMAN	4501 W PEACH	438-0233
Return to:	NEBRASKA TITLE COMPANY ATTN: CATHY	5635 "O" ST #101 LINCOLN NE 68510	486-4900

Signature of Applicant Nebraska Title Co by [illegible] Address 5635 "O" ST #101 LINCOLN NE 68510 Date 6/23/97

HEALTH DEPARTMENT USE ONLY

Date Received 6/24/97 Received $150.00 Check ☒ #375 Cash ☐

PRELIMINARY STATUS--By John J Chen **DATE:** 6/30/97

WATER SYSTEM:	Approved	Disapproved
Construction	☑	☐
Bacteria	☑ 0 /ml	☐ ____ /ml
Nitrate	☒ <0.1 ppm	☐ ____ ppm

SEWAGE SYSTEM		Additional Site Visits
Approved	☑	Date ___/___/___ by ____
Provisional	☐	Date ___/___/___ by ____
Disapproved	☐	Date ___/___/___ by ____

Comments: IF The Septic TANK has not been pumped recently, it should be checked to see if it is Necessary. No visible Signs of surface discharge noted. Accordings to owner, The drain pipe is hooked to the guttering for the roof. See Attached Letter ☐

FINAL STATUS

WATER SYSTEM: Approved: ☒ **SEWAGE DISPOSAL SYSTEM** Approved: ☑ Provisional Approval: ☐

Approved by Jerrold C. Hood R.E.H.S. Date 7/3/97

Approval or disapproval is based on State and local standards for construction, location and water quality. Inspection is based on visible construction and operation at the time of inspection. Approval or provisional approval does not imply or express a guarantee of system operations.

Cpl "6" reported via phone